

As a part of our environment protection policy, we do not offer printed copy of this document. We strongly discourage printing of documents unless absolutely necessary.



PROGAUGE DISPLAY UNIT

This document is applicable to firmware version **V1.30**

USAGE NOTICE

This software / document / material are property of MICRONBEATS Metrology Solutions. It has been provided for the exclusive use of customers for the products of MICRONBEATS. It must not be copied, saved or duplicated in full or in part in any form without the written permission of MICRONBEATS Metrology solutions. Unauthorized copying, duplication or reproduction of this material is restricted and may attract severe legal penalties.

The specifications and features mentioned in this document are available at the time this document was prepared. Utmost care has been taken to maintain accuracy and consistency of the information. However, MICRONBEATS Metrology solutions does not guarantee this document to be free from errors and use of the information is at sole responsibility of the user. MICROBEATS Metrology solutions reserves the right to change or modify this document at any time without prior notice.

Product models

Model Number	Model No. Description	Salient features
ProGAUGE AR11V0	Single Air input, Single result tricolor display unit	Base model <ul style="list-style-type: none"> • Single row, 1" tricolor, six-digit display. • 16x2 LCD display. • Two relays (Accept and reject). • No RTC. • No internal storage. • No Auto-offset correction port.
ProGAUGE AR11V1	Single Air input, Single result tricolor display unit	In addition to base model <ul style="list-style-type: none"> • Internal RTC • Up to 10500 records internal storage. • Three relays (Accept, Reject, Rework). • Auto offset correction port. • Auto-correction script support on RS232 • AutoSave and Auto Sense facility.
ProGAUGE AR11V2	Single Air input, Single result tricolor display unit	All Features of ProGAUGE AR11V1 <ul style="list-style-type: none"> • Built-in air saver
ProGAUGE PR11V0	Single probe input, Single result tricolor display unit	Base model <ul style="list-style-type: none"> • Single row, 1" tricolor, six-digit display. • 16x2 LCD display. • Two relays (Accept and reject). • No RTC. • No internal storage. • No Auto-offset correction port.
ProGAUGE PR11V1	Single probe input, Single result tricolor display unit	In addition to base model <ul style="list-style-type: none"> • Internal RTC • Up to 10500 records internal storage. • Three relays (Accept, Reject, Rework). • Auto offset correction port. • Auto-correction script support on RS232 • AutoSave and Auto Sense facility.

Table of Contents

1. Introduction
2. Features
3. Specifications
 - A. Functional specifications
 - B. Electrical specification
 - C. Performance specifications
 - D. Mechanical specification
4. Keypad functionality
5. Screen functionality
6. Many peripherals can be connected to a display Unit
7. How to do mastering
8. Connection details
9. Measurement cycle
10. Data transmission frame format

1. Introduction



The **ProGAUGE** series covers **one channel and one result** tricolor display unit, suitable for gauging applications. A display unit that can deliver excellent and precise performance. The bright tricolor digits and large font on the LCD. The tri-color digit changes color between green, red and yellow depending on the component status- **ACCEPT**, **REJECT** and **REWORK**. Virtually maintenance free, these devices have been in use over many years in industry delivering excellent measurement performance in varying industrial environments.

The display unit can be used for various measuring fixtures such as bores, shaft diameter, cylindrical work piece, ovality, and roundness.

2. Features

- 1" Tricolor digit display for showing measured value.
- 16X2 Big font alphanumeric LCD display for settings and configuration.
- 10500 records internal storage capacity with timestamp and program number.
- Measurement unit can be in mm or Inch.
- Built-in real time clock. Low battery warning feature for timely replacement of battery.
- **Accept /Reject /Rework** output relay.
- Built-in air saver feature (This feature can be enabled or disabled according to the requirement).
- Auto correction (This feature can be enabled or disabled according to the requirement).
- Rejection BIN interlock (This feature can be enabled or disabled according to the requirement).
- Up to 16 manually selectable program settings.
- 0.1 μ m, 0.2 μ m, 0.5 μ m, 1 μ m, 2 μ m, 5 μ m, 10 μ m Least count options.
- Absolute/relative measurement.
- RS232 for computer connectivity.
- AutoSave and Auto Sense facility.
- Additional RS232 serial port for auto-correction communication or connecting IO expansion board.

3. Specifications

a. Functional specifications

- Communication settings: RS232 interface, no parity, 8 data bits, one stop bit
- Baud rate: Settable as 4800, 9600, 19200, 38400, 57600(Factory default is 19200)
- Resolution options for probe: 0.01micron, 0.1micron, 0.5micron, 1micron
- Measurement range for probe: $\pm 1\text{mm}$, $\pm 2\text{mm}$, $\pm 4\text{mm}$.

b. Electrical specifications

- Power supply: 110VAC to 265VAC, 50/60Hz.Fused with 1A slow blow glass fuse. A stable earth point is must for proper operation of the device
- Probe excitation: 2.5Vpp sine wave. 10 KHz for full bridge LVDT and 13 KHz for half bridge
- Probe Compatibility: TESA / PETER HIRT / SOLARTRON / DONG-DO / BAKER
- Output: 3 relay outputs.

c. Performance specifications

Following performance specifications have been identified at test lab when all the power supply specifications and operating conditions are at nominal values. These values may vary depending upon the field conditions. Proper care must be taken when high precision gauging is required.

- **Accuracy**
 $\pm 0.1\%$ within linear operation of inductive probe (1micron over the range of 1mm)
- **Drift**
0.3micron over a period of 1hour
- **Repeatability**
After power cycle: 0.2micron
After mechanical movement: 0.2micron.
- **Stability**
 $\pm 0.15\text{micron}$ of nominal measured value at fixed position
- **Maximum sampling time**
For inductive probe: 1mSec (1000samples per second)
- **Warm-up time**
The device must be allowed to stabilize for at least 60seconds before actually using the measurement reading from the connected probes. Although instrument requires much less time to stabilize, it is good practice to allow some spare time after power on. The warm-up delay may not be required when instrument is powered off and then on within short time.

d. Mechanical specification

- 271mm (L) X 190mm (W) X 138mm (H).

4. Keypad functionality

- There are six keys on keypad

I. UP Arrow Navigation Key



This key is used for scrolling options when entering system settings mode. This key is also useful when entering digit values into the program setting mode.

II. DOWN Arrow Navigation Key



To return to the previous screen, use the down key.

 
III. Right Arrow/NEXT Navigation Key



To move to the next system setting option without saving the changes made while in the system settings mode, use this key.


This key is also useful when you are in the program setting mode. When entering values for different parameters such as LSL, USL, nominal value, higher master, lower master, etc. While entering digit values, use this key to move from the left decimal place to the right decimal place.

IV. SET key



This key is used to enter into the system setting mode. For entering into the system setting mode first turn off the device press and hold "SET" key then turn on device and hold the set key until you see on screen message "SYSTEM SETTINGS ENTR TO CONTINUE".

 V. ENT key



This key has dual functionality. When in setting mode, the 'ENT (enter)' key is used to enter the setting mode, save the selected values of the current option, and move to the next option. When in measurement mode, the 'ENT (enter)' key is used to transmit the current measurement data to the PC via serial communication.

VI. CLR Key



To clear the current screen, click on the CLR key.

VII. M1 key



M1 key is used to enter mastering mode. Entering into mastering, press the M1 key first. The message shown on screen 'PLACE PLUG IN HIGHER MASTER.' After placing the plug into the higher master, press the 'M1' key to save the M1 master value.


VIII. M2 key



The message shown on screen 'PLACE PLUG IN LOWER MASTER.' After placing the plug into the lower master, press the 'M2' key to save the M2 master value.

5. Screen functionality

➤ DEVICE NAME

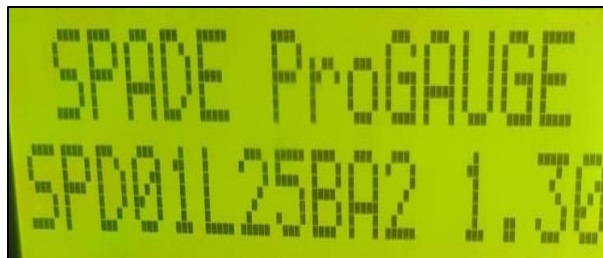

➤ SYSTEM SETTING

This is menu where you can configure your device. For entering into system settings mode, turn off the device and press and hold the "SET" key and turn on the device. keep pressing the "SET" key until it will show "SYSTEM SETTINGS ENTR TO CONTINUE", then press "ENT" key.




I. MEASUREMENT UNIT

This is the measurement unit selection option.



- **MM- (millimeter)**- Select mm to display the final results in millimeters.

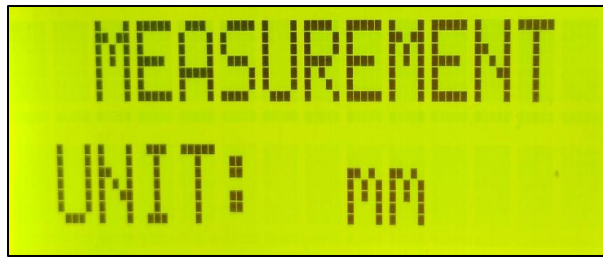

- **Inch**- Select inch to display the final results in millimeters.



II. RESULT DISPLAY LC


- When metric unit is selected
0.0001mm,0.0002mm,0.0005mm,0.001mm,0.002mm,0.005mm,0.010mm.
- When Inch unit is selected
0.00001",0.00002",0.00005",0.0001",0.0002",0.0005",0.001".



III. COMMUNICATION BAUD RATE

Using this option, select the baud rate for the communication between the display device and the computer. The communication baud rates are 4800, 9600, 19200, 115200 and

- **19200**

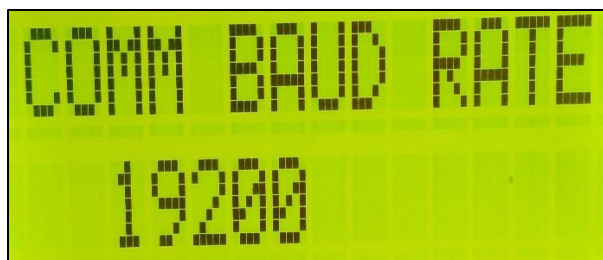

For selecting your desired baud, scroll using "UP^" key and then press "ENT(enter)" for saving the baud setting.

IV. BUZZER STATUS

This feature provides you audio indication on key press.

- **ENABLED**



- **DISABLED**



For selection scroll "UP^" and press "ENT" key for saving your selection.

V. AUTO DATA SEND DELAY

Auto data send delay can be set from 1 seconds to 15 seconds. The part's dimensions are automatically saved according to the set delay.



DISABLED: The dimensions of the part are not saved automatically.



- **AUTO CORRECTION**

Can be used to automatically correct the offset value based on the multi gauge measurement. The upper and lower limits for auto correction can be set at closer. Auto correction types are BCD and Binary.



Ex-Desired DIN-20.000mm

Measured value-20.015mm

Error-0.015mm/15 μ


VI. AUTO-SENSE ON/OFF

The auto-sense concept in multigauging refers to the ability of the gauge to automatically detect the dimensions of the part being measured. If auto sense ON that time auto sense delay screen show.

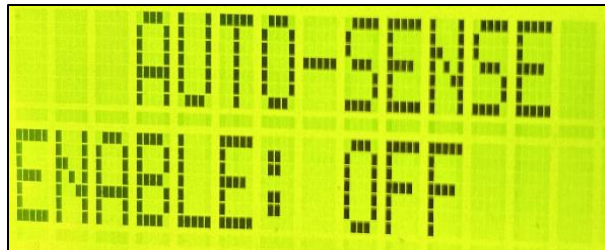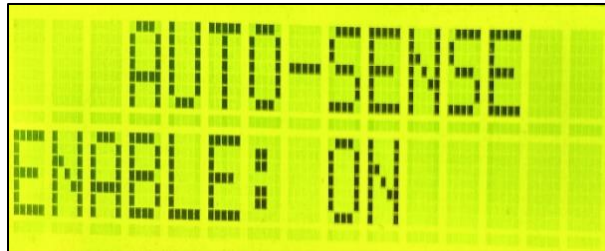

- **AUTO-SENSE DELAY**

Auto sense delay can be set from 1 second to 10 seconds. The part's dimension is measured automatically based on the set delay.

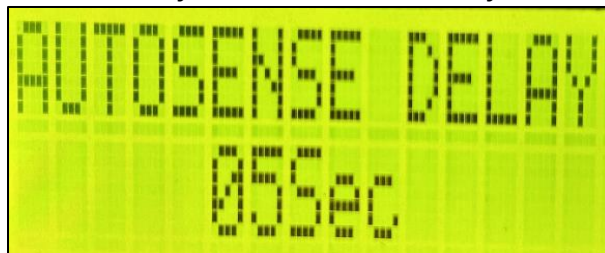


VII. DEVICE ID

This feature provides you to manage or identify your display device. You can give device identification number for you ease. This device id is recorded into each transmitted data frame, using this device id you can bifurcate particular device data from your database. You can set minimum "01" and maximum device is "25".



VIII. SEND ALL STORED DATA TO PC?

This feature provides you facility to transmit stored measurement data to the PC via serial communication for analysis or report generation. If you want to send data Press “TX/ENT” key and wait. The internal storage capacity has 10500 records, but if there are more, new records will override the older ones.

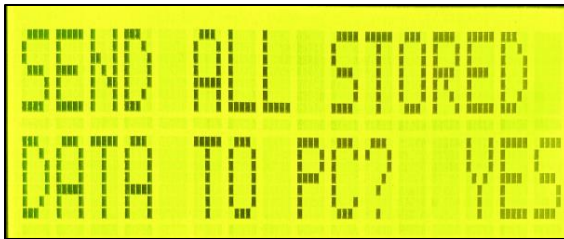

Then press “If you don't want to send the data NEXT→”key to move to the next option.

IX. DELETE ALL STORED DATA?

This feature provides you to erase all you recorded measurement data permanently. Once you deleted your all data there is no way to get it back. So be careful when you delete data. If you want to delete all your data, then press “TX/ENT” key. Data will be successfully deleted.




If you don't want to delete all your data then press “NEXT→”key for moving to next option without deleting data.

X. DATE TIME

Current date and time is displayed. If required, user can change it as shown on following screen.


RTC: It gives us time as well as date information.

Low Battery: If the battery drops below approximately 2.5V, a low battery error message will be displayed.

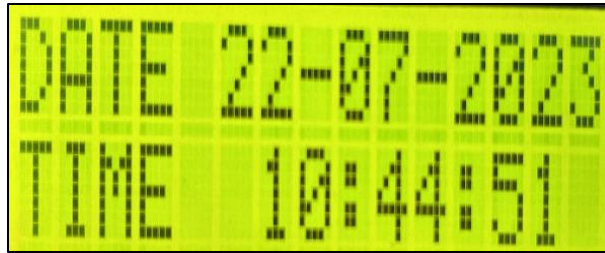


XI. NEW DATE/TIME UPDATED.

Can update Date and time.

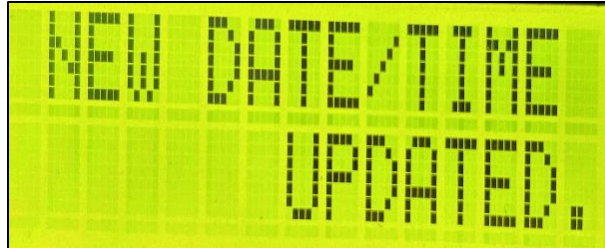


XII. OPEN PLUG COUNT

To measure the open plug count, remove the plug in ring then show the ADC count and this ADC count enter here.

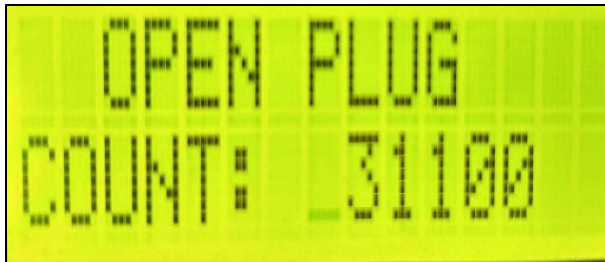

XIII. SYSTEM INFORMATION SCREEN

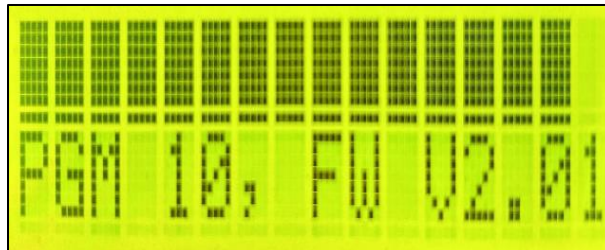

➤ **PROGRAM SETTING**

Whenever you turn on the device you will get only two options on screen, ADC count and Manual program select. You can switch between options by pressing “NEXT→” Key.

I. ADC COUNT

Shows the ADC count readings on the seven segment LED display.



II. MANUAL PROGRAM SELECT “01”

Using this option, you can load the parameters value for any program. For selecting program scroll up using “^UP” arrow key and press “ENT” key.



After entering into program settings you will get following parameters.

III. IN SETTING MODE


• **NOMINAL VALUE**

000.000 is default nominal value. User need to enter nominal value of the components to be used for measurement. Nominal value is used for showing measurement result in absolute mode only. For relative display mode, nominal value is not required. The nominal value lies between upper and lower limits. and nominal size lies between these limits.




• **UPPER LIMIT**

This is upper specified limit of the dimensional measurement. When measurement value is above this limit, the component is for rework or reject depending upon direction.

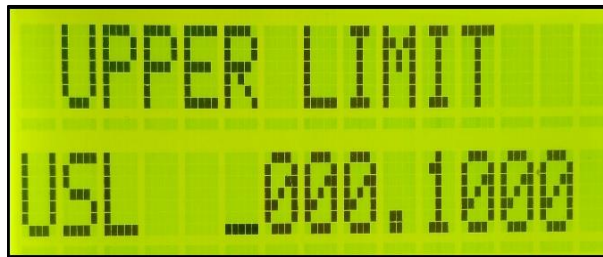

- **LOWER LIMIT**

This is lower specified limit of the dimensional measurement. When measurement value is below this limit, the component is for rework or reject depending upon direction.

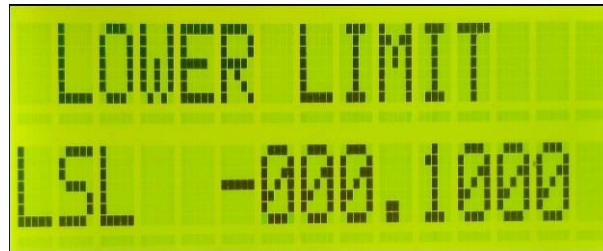


IV. MEASUREMENT MODE

There are five measurement modes

- **CURRENT**

In this mode, device will show current measured reading on digits and same is used for deciding the final result as ACCEPT, REJECT or REWORK.

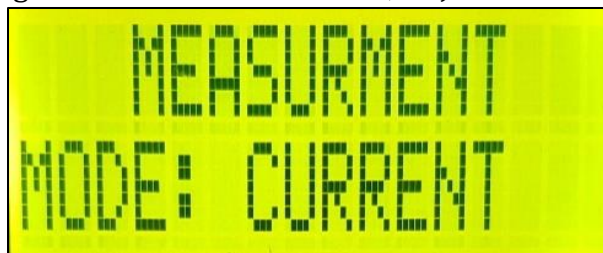

- **AVERAGE**

In this mode, device will show average measured reading on digits and same is used for deciding the final result as ACCEPT, REJECT or REWORK. ENTER key can be used for resetting the averaging function.



- **MINIMUM**

In this mode of will take minimum value and displayed as final result. Measurement device will take measurements and from that measurement it.



- **MAXIMUM**

In this mode of measurement device will take measurements and from that measurement it will take maximum value and displayed as final result.




- **TIR**

In TIR mode total traverse of readings during measurement cycle are shown as result.



- **MEAN**


In Mean mode mean of all readings are shown as result.

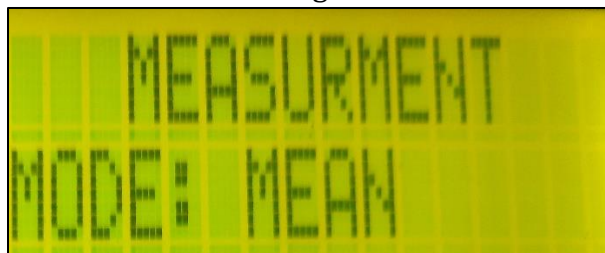

V. RESULT DISPLAY MODE

- **RELATIVE**

In this mode nominal value will not be considered for final result display. Direct measurement value is shown on display as final result.

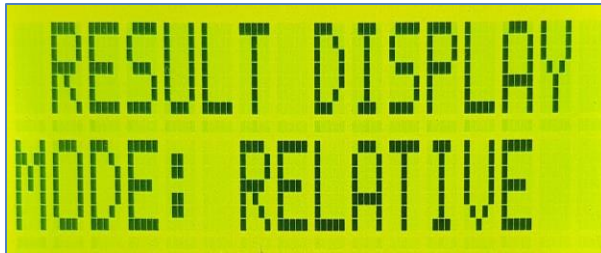

RESULT DISPLAY
MODE: RELATIVE

- **ABSOLUTE**

In this mode nominal value will be added to the obtained measurement value and then final result will be displayed.



RESULT DISPLAY
MODE: ABSOLUTE

VI. MASTERING

- **DOUBLE**

When two reference masters are available for measurement, choosing double mastering is required for calibration. This is mandatory step. Double mastering must be done at least once before doing single mastering.



PROGRAM 01
MASTERING: DOUBL

- **SINGLE**

When there is only one reference master available, choose single master mode. Single mastering will work only when double mastering is already done at least once for that program.



PROGRAM 01
MASTERING: SINGL


VII. LOWER MASTER VALUE

Enter the actual value of the master that was mentioned on the master component



VIII. HIGHER MASTER VALUE

Enter the actual value of the higher master that was mentioned on the higher master component.

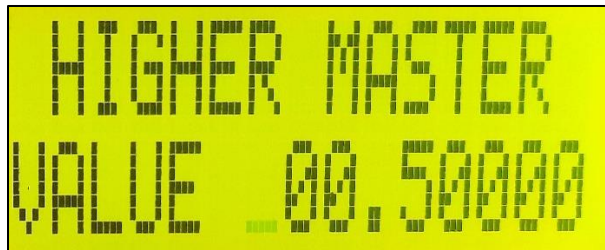

XIV. MEASURING DIRECTION


- **ID (Internal Diameter)**

For measuring internal diameter of component choose this option else results are different. If measurement direction is ID in that case readings goes above higher limit values result will be REJECT, and if readings go below lower limit values result will be REWORK.

EX-ID=15.20 mm

If ID is 15.25mm then **Reject** Condition

If ID is 15.15mm then **Rework** Condition

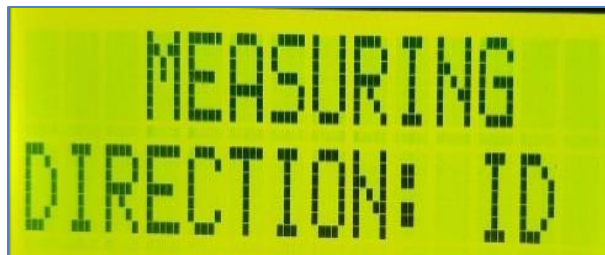

- **OD (Outer Diameter)**

For measuring outer diameter of component choose this option else results are different. If measurement direction is OD in that case readings goes above higher limit values result will be REWORK and if readings go below lower limit values result will be REJECT.

EX-OD=20.20 mm

If OD is 20.30mm then **Rework** Condition

If OD is 20.10mm then **Reject** Condition

- **RANGE**

If the user wants to check and accept components only within a certain range, and all components outside of that range are rejected, then select this option.


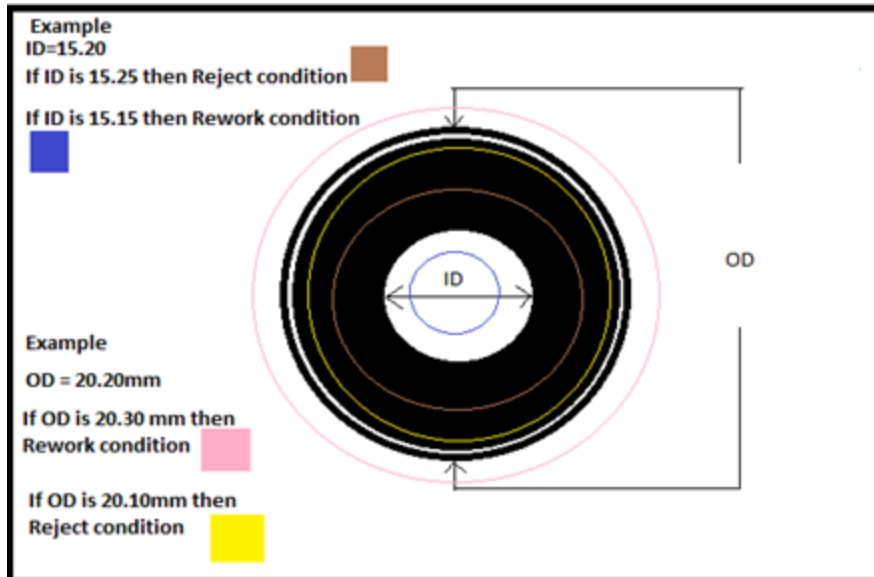


Figure 1


XV. AUTO SENSE DIRECTION

select the auto sense direction Above or Below. If the cycle start trigger is expected when the value goes above idle value, select Above. Otherwise select Below.

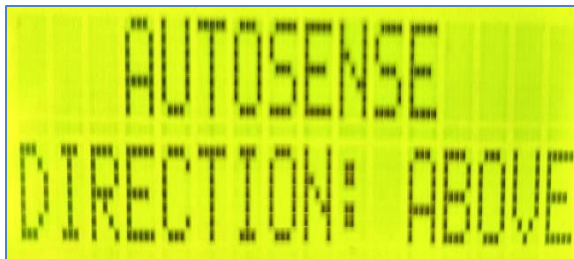

XVI. AUTO SENSE LIMIT


Enter Auto sense limit.

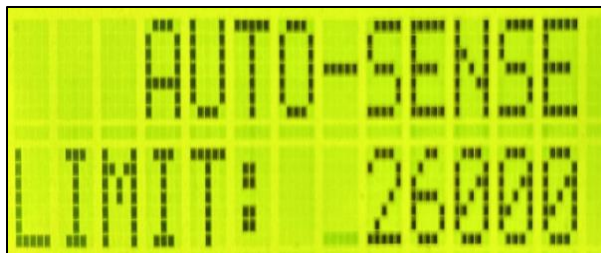

➤ **RESULT MODE**

INPUT COMPONENT REJECTION BIN

If the component is rejected, the following screen will show.

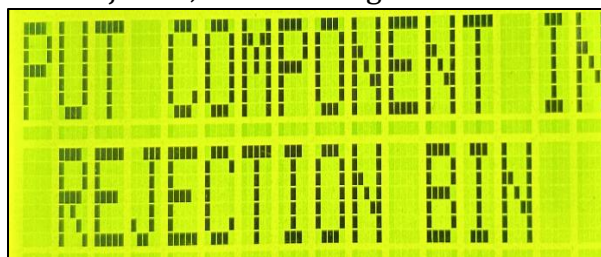

6. Many peripherals can be connected to a Spade ProGAUGE display unit

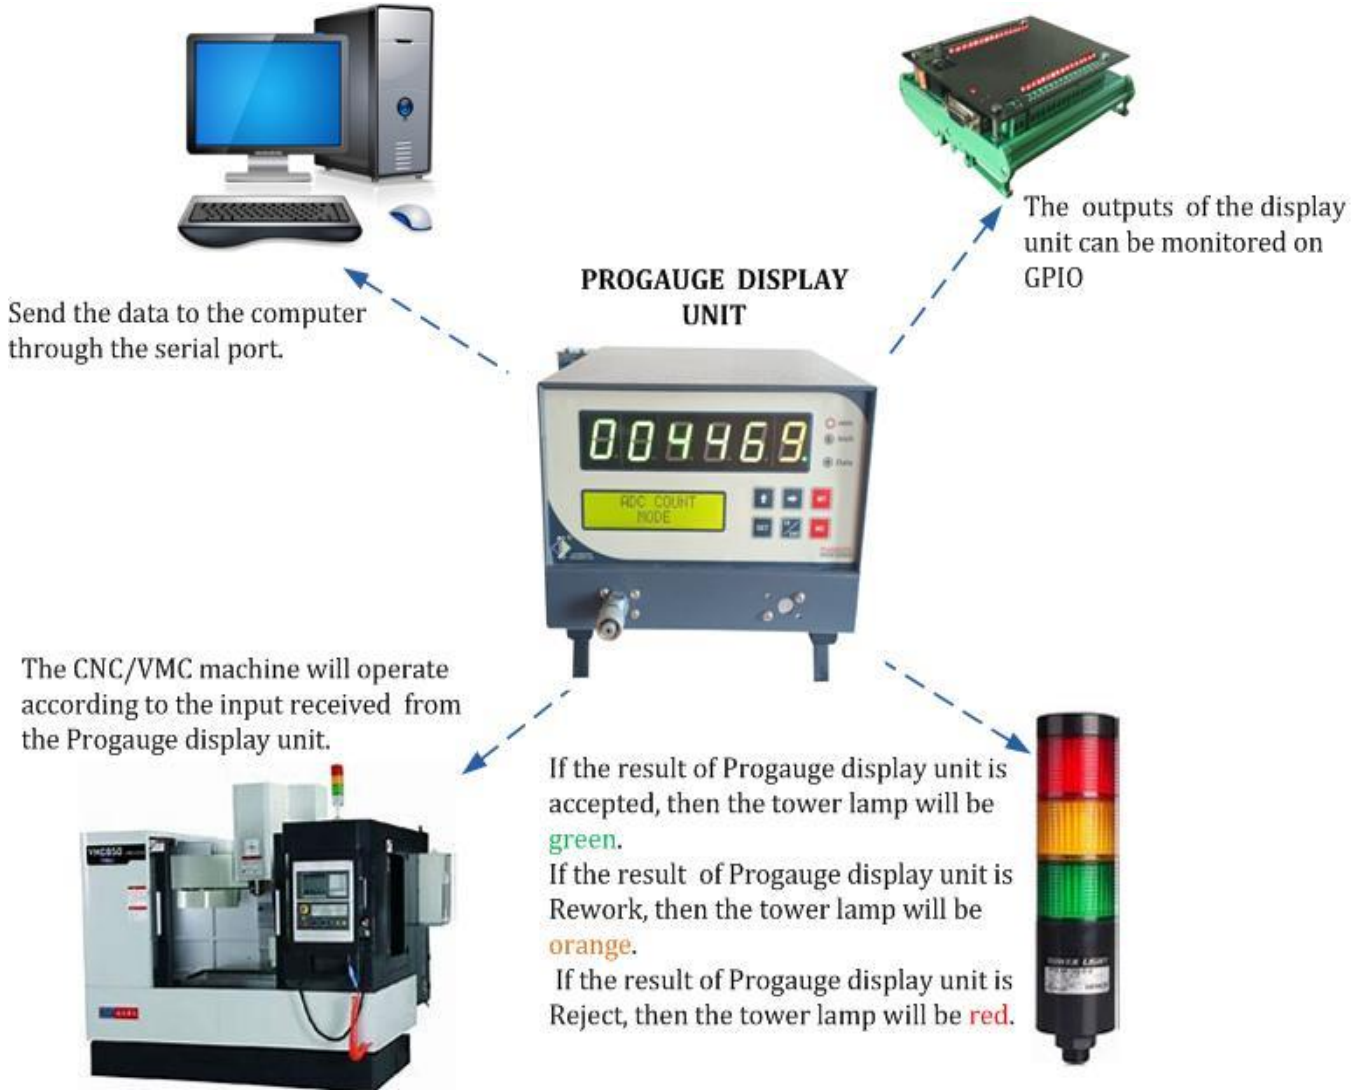


Figure 2

7. How to do Mastering

➤ Double Mastering

Note: When two reference masters are available for measurement, choosing double mastering is required for calibration. This is mandatory step. Double mastering must be done at least once before doing single mastering

1. Select double mastering.
2. Pressing M1, the screen will show the message 'PLACE PLUG IN HIGHER MASTER'.
3. After placing the plug into the higher master, press the M1 key, and the screen will show the message 'PROGRAM 01 CAPTURING M1'.
4. The screen will show the message 'PLACE PLUG IN LOWER MASTER'.
5. After placing the plug into the lower master, press the M2 key and the screen will show the message 'PROGRAM 01 CAPTURING M2.'
6. The message "MASTERING DONE ENTER TO SAVE" will display.

➤ Single Mastering

Note: When there is only one reference master available, choose single master mode. Single mastering will work only when double mastering is already done at least once for that program

1. Select single mastering.
2. Pressing M1, the screen will show the message 'PLACE PLUG IN MASTER'
3. After placing the plug into the master, press the M1 key, and the screen will show the message 'PROGRAM 01 CAPTURING M1'.
4. The message "MASTERING DONE ENTER TO SAVE" will display.

8. Connection Detail

➤ Result status relay connection

9 Pin round Connector	Relay Connection	Relay
1	NC	ACCEPT Relay
2	CMN	
3	NO	
4	NC	REJECT Relay
5	CMN	
6	NO	
7	NC	REWORK Relay
8	CMN	
9	NO	

Table 1

➤ Foot-switch connection

4 Pin round connector	Connection
1	Common
2	Footswitch-1
3	Footswitch-2
4	NC

Table 2

- To operate Foot-switch-1 connect one terminal of switch to common (pin1 of 4pin connector) and another terminal to Foot-switch-1 (pin2 of 4pin mx male connector)
- To operate Foot-switch-2 connect one terminal of switch to common (pin1 of 4pin mx male connector) and another terminal to Foot-switch-2 (pin3 of 4pin mx male connector)

➤ Extension/cascading cable connections

Display Unit has mx 3pin male connector for extension interface. Using this feature user can cascade up to 5 interface units. For extension purpose DB9MALE to 3pin female three core cable is required. Below are pin details for this cable figure 3.

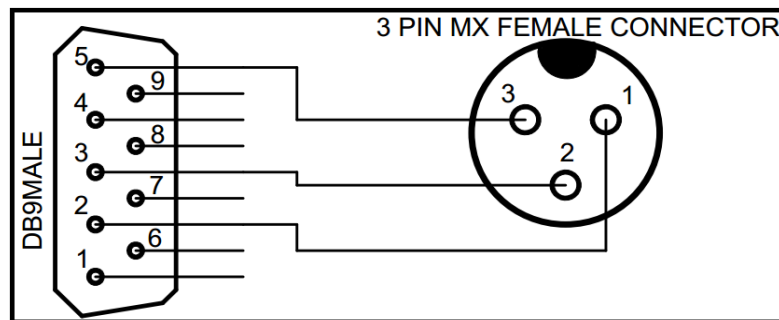


Figure 3

3-Pin round Male Connector On Backside	DB9 Female
1	RXD
2	TXD
3	GND

Table 3

➤ **Serial Communication Port**

Display unit has D sub miniature 9pin female connector for serial interface. Below are pin details for this connector. If the is being connected to computer’s serial port, one to one straight three core cable is required.

DB9 Pin	Signal Name
1	NC
2	TXD RS232
3	RXD RS232
4	NC
5	GND
6	FOOT- SWITCH COMMON
7	FOOT- SWITCH-1
8	FOOT- SWITCH-2
9	P1.11

Table 4

- **Table Terminology**

NC: Do not make any electrical connection to these pins. Some or all of these pins might be used for internal testing and factory settings.

GND: Supply negative.

Warning: Wrong connection or over voltage at any of the D type connector pin may permanently damage the device.


9. Measurement Cycle for Auto Program selection

For Auto program selection mode GPIO device should be properly connected to the display device. If GPIO device is not connected "INPUT EXTENSION NOT RESPONDING" error message shows on display screen.

- To start measurement cycle first check all the plugs are within the proximity of the sensor/rest position.
- Lift any one plug at a time then its respective program will be automatically selected.
- Put lifted plug into its respective component for measurement.
- Measurement status will be displayed on screen as Accept, Reject or Rework.
- Press "ENT" key or press foot switch once for saving the cycle result status into the device and at same time transmitting over serial port.
- Put plug back to its rest position.
- One measurement cycle completed.
- Repeat same procedure for all plugs.

10. Data Transmission Frame Format

A data frame is sent over RS232 port at predefined interval. All the data is in ASCII format and can be viewed on hyper terminal. Default interval setting is 50mSec and default baud rate is 19200. The data frame is always terminated by ASCII code of carriage return.

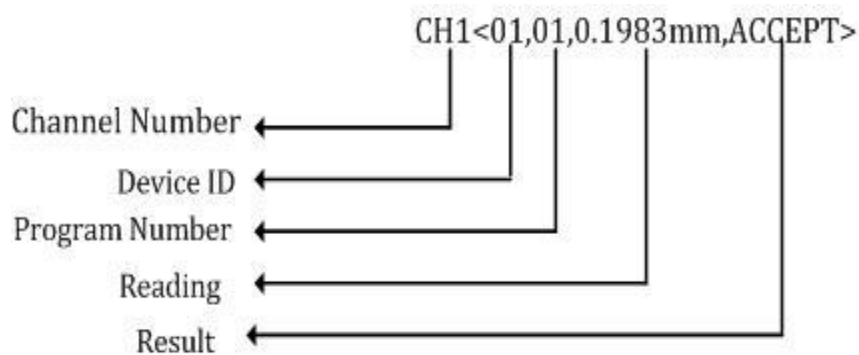

Warranty statement

All the products are covered under warranty for a period of 12 months against Manufacturing defects, workmanship and malfunction under normal operating conditions. The warranty is subject to the terms and conditions mentioned below.

1. The warranty commences from the date of sale for a period of 12 months irrespective of the actual installation date.
2. The warranty is against manufacturing defects and any subsequent malfunction of the instrument during the normal operation. The warranty shall not be applicable in case of accidental damage, damage due to wrong operation, connection or conditions that are out of normal operating specifications.
3. MICRONBEATS Metrology Solutions, at its discretion may repair or replace the product depending on the condition of instrument, availability of spare parts and type of failure.
4. In case of warranty claim, the warranty period will not be extended and remains same as stated earlier from the date of sale.
5. Maximum liability of MICRONBEATS Metrology Solutions remains up to repair or replacement of the product only. Any damages or losses raised out of use of the instrument are not covered by this warranty. In any case, cost of the product will not be refunded.
6. In case of warranty claim, the product should be sent over to MICRONBEATS Metrology Solutions immediately after noticing the defect or failure. A detailed note of operating conditions in which fault occurred will be helpful in rectifying the defect.
7. Do not try to open or repair the instrument on your own. Warranty will stand null and void in such case. Products with tampered warranty seal will not be considered for warranty claims and regular service charges will be applicable.
8. In all claims, the company's decision will be final and legally binding.
9. Any and all disputes are subject to pune jurisdiction only.

Micronbeats Metrology Solutions
#226, Laxmi colony, Lane No.5,
Behind Manish
market, Hadapsar, Pune – 411028.
www.Micronbeats.com
Email: sales@micronbeats.com