

As a part of our environment protection policy, we do not offer printed copy of this document. We strongly discourage printing of documents unless absolutely necessary.



SUPER DISPLAY UNIT

This document is applicable to firmware version **V2.01**

USAGE NOTICE

This software / document / material are property of MICRONBEATS Metrology Solutions. It has been provided for the exclusive use of customers for the products of MICRONBEATS. It must not be copied, saved or duplicated in full or in part in any form without the written permission of MICRONBEATS Metrology solutions. Unauthorized copying, duplication or reproduction of this material is restricted and may attract severe legal penalties.

The specifications and features mentioned in this document are available at the time this document was prepared. Utmost care has been taken to maintain accuracy and consistency of the information. However, MICRONBEATS Metrology solutions does not guarantee this document to be free from errors and use of the information is at sole responsibility of the user. MICROBEATS Metrology solutions reserves the right to change or modify this document at any time without prior notice.

Product models

Model Number	Model No. Description	Salient features
Super AR24V0	Two Air input, Four result tricolor display unit.	Base model • Two rows,0.56" tricolor, six-digit display. • 16x2 LCD display. • Two relays (Accept and reject). • No RTC. • No internal storage. • No Auto-offset correction port.
Super AR24V1	Two Air input, Four result tricolor display unit.	In addition to base model • Internal RTC • Up to 21500 records internal storage. • Three relays (Accept, Reject, Rework). • Auto offset correction port. • Auto-correction script support on RS232 • Auto Save and Auto Sense facility.
Super AR24V2	Two Air input, Four result tricolor display unit.	All Features of Super AR24V1 • Built-in air saver
Super PR24V0	Two probe input, Four result tricolor display unit.	Base model • Two rows,0.56" tricolor, six-digit display. • 16x2 LCD display. • Two relays (Accept and reject). • No RTC. • No internal storage. • No Auto-offset correction port.
Super PR24V1	Two probe input, Four result tricolor display unit.	In addition to base model • Internal RTC • Up to 21500 records internal storage. • Three relays (Accept, Reject, Rework). • Auto offset correction port. • Auto-correction script support on RS232 • Auto Save and Auto Sense facility.
Super AR44V0	Four Air input, Four result tricolor display unit	Base model • Four rows,0.56" tricolor, six-digit display. • 16x2 LCD display. • Two relays (Accept and reject). • No RTC. • No internal storage. • No Auto-offset correction port.

MICRONBeats metrology solutions
Spade Super display unit user manual V1.00

Super AR44V1	Four Air input, Four result tricolor display unit	In addition to base model • Internal RTC • Up to 21500 records internal storage. • Three relays (Accept, Reject, Rework). • Auto offset correction port. • Auto-correction script support on RS232 • Auto Save and Auto Sense facility.
Super AR44V2	Four Air input, Four result tricolor display unit	All Features of Super AR44V1 • Built-in air saver
Super PR44V0	Four probe input, Four result tricolor display unit	Base model • Four rows, 0.56" tricolor, six-digit display. • 16x2 LCD display. • Two relays (Accept and reject). • No RTC. • No internal storage. • No Auto-offset correction port.
Super PR44V1	Four Air input, Four result tricolor display unit	In addition to base model • Internal RTC • Up to 21500 records internal storage. • Three relays (Accept, Reject, Rework). • Auto offset correction port. • Auto-correction script support on RS232 • Auto Save and Auto Sense facility.

Table of Contents

1. Introduction
2. Features
3. Specifications
 - A. Functional specifications
 - B. Electrical specification
 - C. Performance specifications
 - D. Mechanical specification
4. Keypad functionality
5. Screen functionality
6. Many peripherals can be connected to a display unit
7. How to do mastering and calibration
8. Connection details
9. Measurement cycle
10. Data transmission frame format

1. Introduction



The **SUPER** series covers **two channel and four result, four channel and four result** tricolour display unit, suitable for gauging applications. A display unit that can deliver excellent and precise performance. The bright tricolour digits and large font on the LCD. The tri-colour digit changes colour between green, red and yellow depending on the component status- **ACCEPT**, **REJECT** and **REWORK**. The 21500 has a capacity for internal storage. Virtually maintenance free, these devices have been in use over many years in industry delivering excellent measurement performance in varying industrial environments.

The display unit can be used for various measuring fixtures such as bores, shaft diameter, cylindrical work piece, ovality, and roundness.

2. Feature

- 0.56" Tricolor digit display for showing measured value.
- 16X2 Big font alphanumeric LCD display for settings and configuration.
- Up to 21500 records internal storage capacity with timestamp and program number.
- Metric/Inch measurement unit.
- Built-in real time clock. Low battery warning feature for timely replacement of battery.
- **Accept** / **Reject** / **Rework** output relay.
- Built-in air saver (This feature can be enabled or disabled according to the requirement).
- Auto correction (This feature can be enabled or disabled according to the requirement).
- Rejection BIN interlock (This feature can be enabled or disabled according to the requirement).
- Up to 16 manually selectable program settings.
- 0.1µm, 0.2µm, 0.5µm, 1µm, 2µm, 5µm, 10µm Least count options
- Absolute/relative measurement.
- RS232 for computer connectivity.
- AutoSave and Auto Sense facility.
- Additional RS232 serial port for auto-correction communication or connecting IO expansion board.

3. Specifications

a. Functional specifications

- Communication settings: RS232 interface, no parity, 8 data bits, one stop bit.
- Baud rate: Settable as 4800, 9600, 19200, 38400, 57600 (Factory default is 19200).
- Resolution options for probe: 0.01micron, 0.1micron, 0.5micron, 1micron.
- Measurement range for probe: +/-1mm, +/-1.5mm, +/-2mm, +/-2.5mm, +/-3mm.

b. Electrical specifications

- Power supply: 110VAC to 265VAC, 50/60Hz. Fused with 1A slow blow glass fuse. A stable earth point is must for proper operation of the device.
- Probe excitation: 2.5Vpp sine wave. 10 KHz for full bridge LVDT and 13 KHz for half bridge Tesa compatible probes. (Other factory options available on request).
- Output: 3 relay outputs.

c. Performance specifications

Following performance specifications have been identified at test lab when all the power supply specifications and operating conditions are at nominal values. These values may vary depending upon the field conditions. Proper care must be taken when high precision gauging is required.

- **Accuracy**
±0.1% within linear operation of inductive probe (1micron over the range of 1mm)
- **Repeatability**
After power cycle: 0.2micron
After mechanical movement: 0.2micron
- **Stability**
±0.1micron of nominal measured value at fixed position
- **Maximum sampling time**
For inductive probe: 1mSec (1000samples per second)
- **Warm-up time**
The device must be allowed to stabilize for at least 60seconds before actually using the measurement reading from the connected probes. Although instrument requires much less time to stabilize, it is good practice to allow some spare time after power on. The warm-up delay may not be required when instrument is powered off and then on within short time.

d. Mechanical specification

- 266mm (L) X 61mm (W) X 220mm (H)

4. Keypad functionality

- There are six keys on keypad

I. UP Arrow Navigation Key



This key is used for scrolling options when entering system settings mode. This key is also useful when entering digit values into the program setting mode.

II. DOWN Arrow Navigation Key



To return to the previous screen, use the down key.

III. Right Arrow/NEXT Navigation Key



To move to the next system setting option without saving the changes made while in the system settings mode, use this key.

 
This key is also useful when you are in the program setting mode. When entering values for different parameters such as LSL, USL, nominal value, higher master, lower master, etc. While entering digit values, use this key to move from the left decimal place to the right decimal place.

IV. SET key



This key is used to enter into the system setting mode. For entering into the system setting mode first turn off the device press and hold "SET" key then turn on device and hold the set key until you see on screen message "SYSTEM SETTINGS ENTR TO CONTINUE".

V. ENT key




This key has dual functionality. When in setting mode, the 'ENT (enter)' key is used to enter the setting mode, save the selected values of the current option, and move to the next option. When in measurement mode, the 'ENT (enter)' key is used to transmit the current measurement data to the PC via serial communication.

VI. CLR Key



To clear the current screen, click on the CLR key.

 VII. M1 key



M1 key is used to enter mastering mode. Entering into mastering, press the M1 key first. The message shown on screen 'PLACE PLUG IN HIGHER MASTER.' After placing the plug into the higher master, press the 'M1' key to save the M1 master value.

VIII. M2 key



The message shown on screen 'PLACE PLUG IN LOWER MASTER.' After placing the plug into the lower master, press the 'M2' key to save the M2 master value.

5. Screen functionality

➤ DEVICE NAME



➤ SYSTEM SETTING

This is menu where you can configure your device. For entering into system settings mode, turn off the device and press and hold the "SET" key and turn on the device. keep pressing the "SET" key until it will show "SYSTEM SETTINGS ENTR TO CONTINUE", then press "ENT" key.




I. MEASUREMENT UNIT

This is the measurement unit selection option.



- **MM- (millimeter)**- Select mm to display the final results in millimeters.

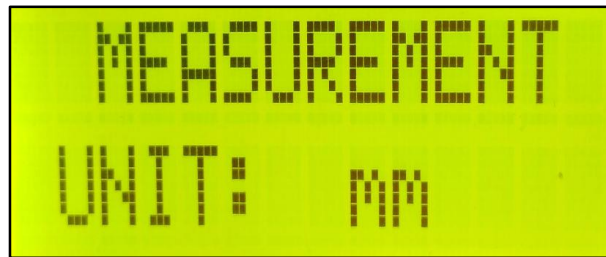

- **Inch**- Select inch to display the final results in millimeters.



II. RESULT DISPLAY LC


- When metric unit is selected
0.010mm,0.001mm,0.002mm,0.005mm,0.0001mm,0.0002mm,0.0005mm.
- When Inch unit is selected
0.001",0.0001",0.0002",0.0005". 0.00001",0.00002",0.00005".



III. COMM BAUD RATE

Using this option, select the baud rate for the communication between the display device and the computer. The communication baud rates are 4800, 9600, 19200, 38400, and 57600

- **19200**

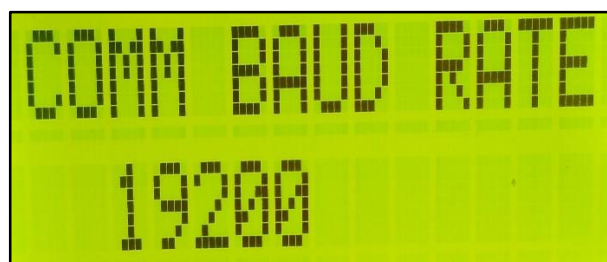

For selecting your desired baud, scroll using "UP^" key and then press "ENT (enter)" for saving the baud setting.

IV. BUZZER STATUS

This feature provides you audio indication on key press.

- **ENABLED**



- **DISABLED**



For selection scroll "UP^" and press "ENT" key for saving your selection.

V. AUTO-SENSE MODE

The auto-sense concept in multigauging refers to the ability of the gauge to automatically detect the dimensions of the part being measured. The sense delay and auto save delay screens will appear if the auto sense mode is selected as sequential or random.

- **SEQUENTIAL**

In sequential mode, all channels are auto sensed separately. It senses one channel after another and back to the first channel.



- **RANDOM**

In random mode, all channels are auto sensed separately.



- **SIMULTANEOUS**

In simultaneous mode, all channels are auto sensed simultaneously.



- **OFF**

If the auto sense is off, the sense delay and auto save delay screen will not appear.



- **SENSE DELAY**

Sense delay can be set from 1 second to 10 seconds. The part's dimension is measured automatically based on the set delay.



- **AUTO-SAVE DELAY**

Auto save delay can be set from 1 seconds to 25 seconds or can be disabled. The part's dimensions are automatically saved according to the set delay.



The dimensions of the part are not saved automatically.



- **AUTO CORRECTION**

Can be used to automatically correct the offset value based on the multi gauge measurement. The upper and lower limits for auto correction can be set at closer. Auto correction types are BCD and Binary
Ex-Desired DIN-20.000mm
Measured value-20.015mm
Error-0.015mm/15 μ


VII.DEVICE ID

This feature provides you to manage or identify your display device. You can give device identification number for you ease. This device id is recorded into each transmitted data frame, using this device id you can bifurcate particular device data from your database. You can set minimum “001” and maximum device id is “050”.



VIII. SEND ALL STORED DATA TO PC?


This feature provides you facility to transmit stored measurement data to the PC via serial communication for analysis or report generation. If you want to send data Press “ENT” key and wait.

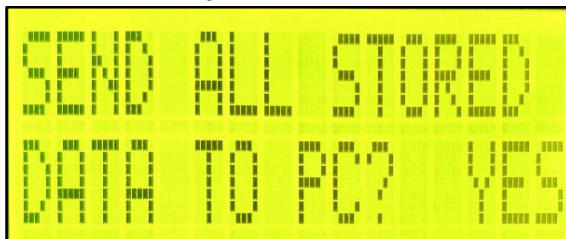

Then press “If you don't want to send the data NEXT→”key to move to the next option.

IX.DELETE ALL STORED DATA?

This feature provides you to erase all you recorded measurement data permanently. Once you deleted your all data there is no way to get it back. So be careful when you delete data. If you want to delete all your data, then press “ENT” key. Data will be successfully deleted.

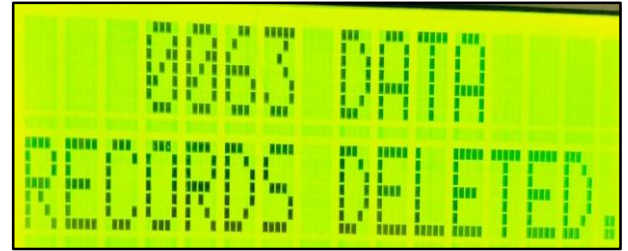


If you don't want to delete all your data then press "NEXT→"key for moving to next option without deleting data.

X. DATE TIME

Current date and time is displayed. If required, user can change it as shown on following screen


RTC: It gives us time as well as date information.

Low Battery: If the battery drops below approximately 2.5V, a low battery error message will be displayed.

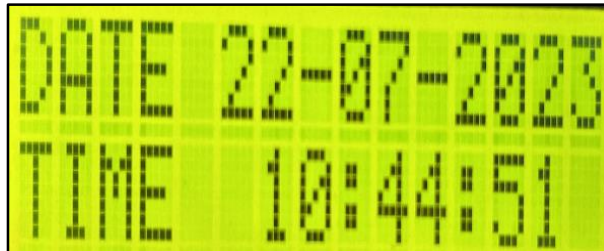

XI. NEW DATE/TIME UPDATED.

Can update Date and time.

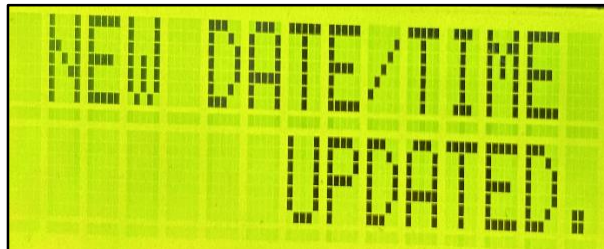

XII.AIR TURNOFF DELAY


Air turnoff delay can be set from 5 seconds to 50 seconds, or disabled.






XIII. OPEN PLUG COUNT

To measure the open plug count, remove the plug in master then show the ADC count and this ADC count enter here.

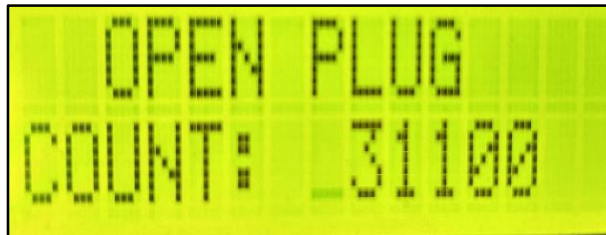

XIV. SYSTEM INFORMATION SCREEN

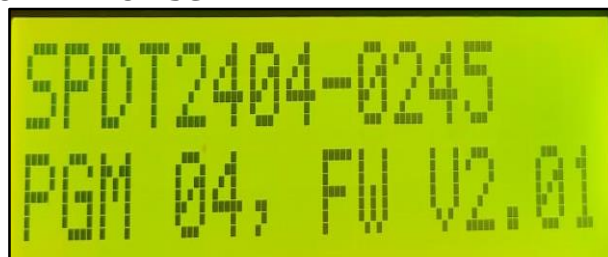


➤ **Program Setting**

Whenever you turn on the device you will get only two options on screen, ADC count and Manual program select. You can switch between options by pressing “NEXT→” Key.

I. ADC COUNT MODE

- **SEPARATE CH**

Shows the ADC count readings on the seven segment LED display. Display the ADC count reading for the separate channel in the display mode.

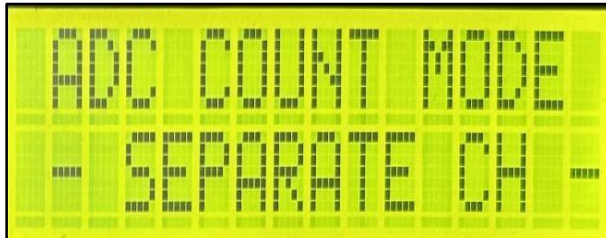


- **COMBINATION**

D1=P1+P2

D2=P3+P4

This combination will display the ADC count.

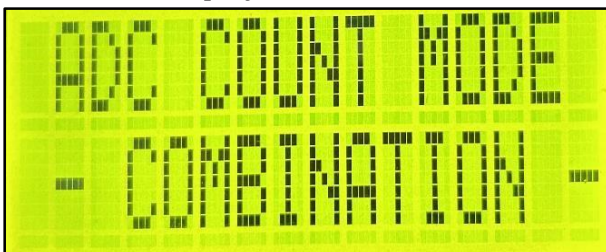

II. MANUAL PROGRAM SELECT “01”

Using this option, you can load the parameters value for any program. For selecting program scroll up using “^UP” arrow key and press “ENT” key.



After entering into program settings you will get following parameters.

III. MASTERING

- **DOUBLE**

when two reference masters are available for measurement, choosing double mastering is required for calibration. This is mandatory step. Double mastering must be done at least once before doing single mastering.



- **SINGLE**

When there is only one reference master available, choose single master mode. Single mastering will work only when double mastering is already done at least once for that program




IV. SENSE VALUE

If the auto sense is off, the sense value and sense direction screen will not appear.




V. SENSE DIRECTION

Select the sense direction Above or Below. If the cycle start trigger is expected when the value goes above idle value, select Above. Otherwise select Below.

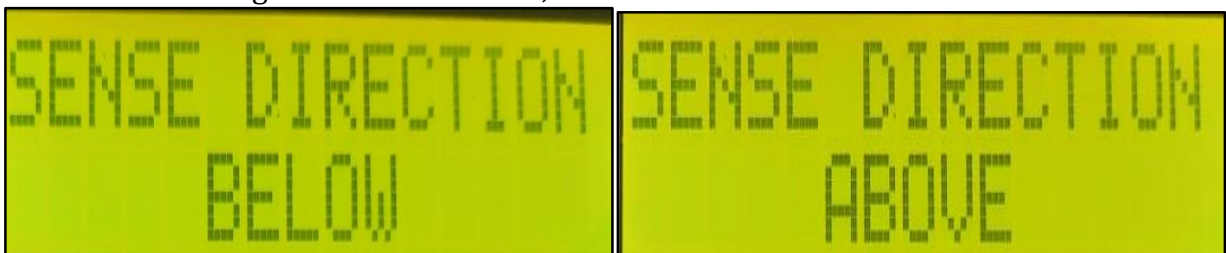


VI. CALIBRATION MODE

- **SIMULTANEOUS:** Calibration Mode Simultaneous means mastering all channels simultaneously

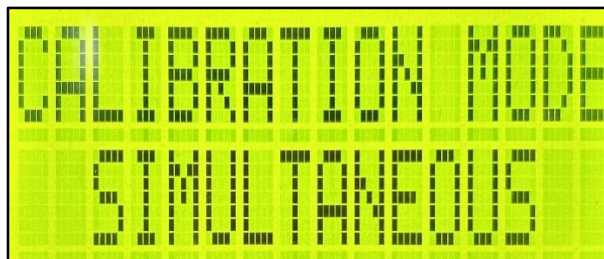


- **STEP CAL:** Calibration Mode Step CAL means mastering all channels Separately

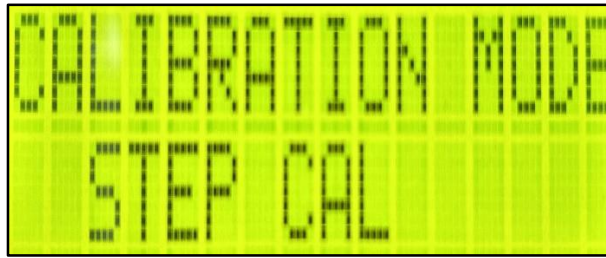


VII. CYCLE TIME

User can set cycle time according to their requirement from minimum 1second to maximum 30 seconds.

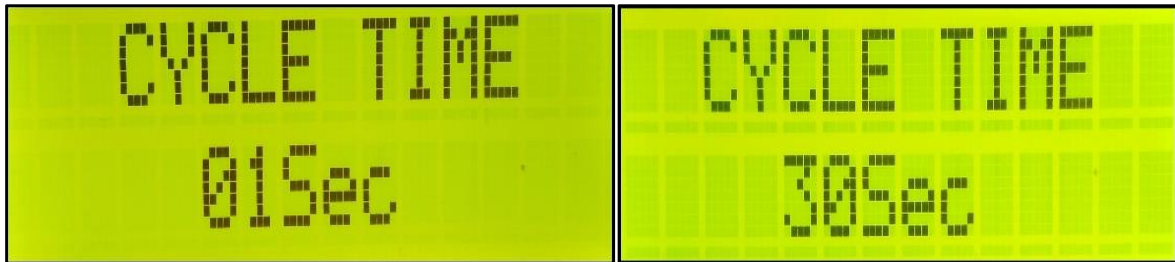

- If user don't want cycle delay, then user can disable it by choosing Disable option

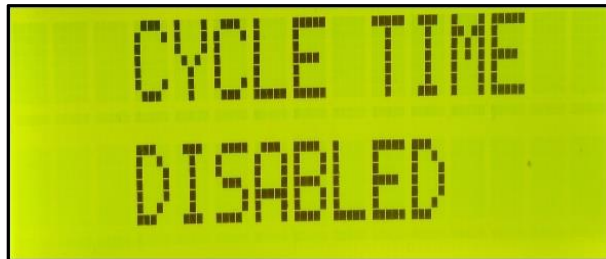


VIII. PROGRAM 01(01 to 16) UPDATE RESULT 01(01 TO 04)

You can set parameters 01 and 04 in programs 01 to 16.



IX. RESULT FORMULA


- $r1 = P1, P2, P3, P4$
- $r2 = P1, P2, P3, P4, R1$
- $r3 = P1, P2, P3, P4, R1, R2$
- $r4 = P1, P2, P3, P4, R1, R2, R3$

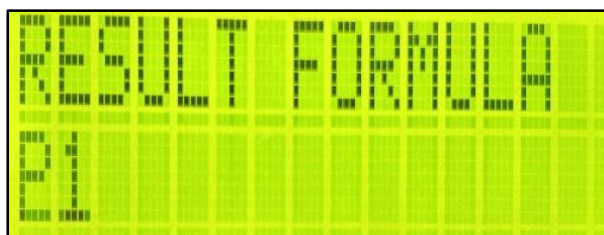

X. IN SETTING MODE

- **NOMINAL VALUE**

000.000 is default nominal value. User need to enter nominal value of the components to be used for measurement. Nominal value is used for showing measurement result in absolute mode only. For relative display mode, nominal value is not required. The nominal value between upper and lower limits.

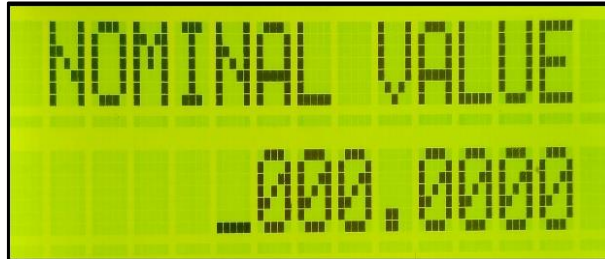

- **UPPER LIMIT**

This is upper specified limit of the dimensional measurement. When measurement value is above this limit, the component is for rework or reject depending upon direction.



- **LOWER LIMIT**

This is lower specified limit of the dimensional measurement. When measurement value is below this limit, the component is for rework or reject depending upon direction



XI. MEASUREMENT MODE

There are five measurement modes

- **CURRENT**

In Current mode actual current moments readings are shown as result.



- **AVERAGE**

In Average mode average of all readings are shown as result



- **MINIMUM**

In Min mode lowest reading of measurement cycle is captured and displayed as result.



- **MAXIMUM**

In Max mode highest reading of measurement cycle is captured and displayed as result.



- **TIR**

In TIR mode total traverse of readings during measurement cycle are shown as result.



- **MEAN**


In Mean mode mean of all readings are shown as result



XII. RESULT DISPLAY MODE

- **RELATIVE**

In this mode nominal value will not be considered for final result display. Direct measurement value is shown on display as final result.

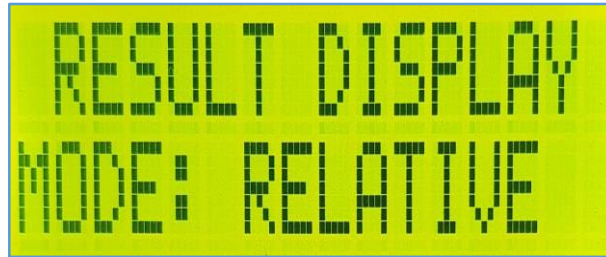

- **ABSOLUTE**

In this mode nominal value will be added to the obtained measurement value and then final result will be displayed.



XIII. MASTERING REQUIRED

- **YES**

Select 'YES' if mastering the parameter in the selected program is required.



- **NO**

Select 'NO' if mastering the parameter in the selected program is not required.



XIV. HIGHER MASTER VALUE

Enter the actual value of the higher master that was mentioned on the higher master component.



XV. LOWER MASTER VALUE

Enter the actual value of the lower master that was mentioned on the lower master component.



XVI. MEASURING DIRECTION

Final results are dependent on these selections.

- **ID (Internal Diameter)**

For measuring internal diameter of component choose this option else results are different. If measurement direction is ID in that case readings goes above higher limit values result will be REJECT, and if readings go below lower limit values result will be REWORK.

EX-ID=15.20 mm

If ID is 15.25mm then **Reject** Condition

If ID is 15.15mm then **Rework** Condition



- **OD (Outer Diameter)**

For measuring outer diameter of component choose this option else results are different. If measurement direction is OD in that case readings goes above higher limit values result will be REWORK and if readings go below lower limit values result will be REJECT.

EX-OD=20.20 mm

If OD is 20.30mm then **Rework** Condition

If OD is 20.10mm then **Reject** Condition

- **RANGE**

If the user wants to check and accept components only within a certain range, and all components outside of that range are rejected, then select this option.

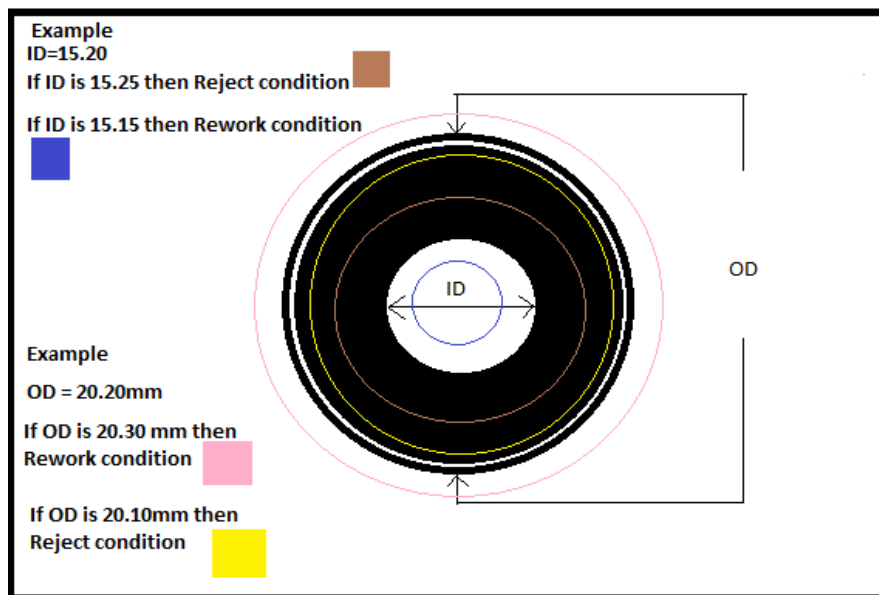


Figure 1


XVII. RESULT 1 DONE UPDATE RESULT 2?

If RESULT 2 is update, select YES.



Note: If RESULT 1 is done. To set RESULT 2, RESULT 3, and RESULT 4, repeat the process of RESULT1.

XVIII. RESULT 4 DONE

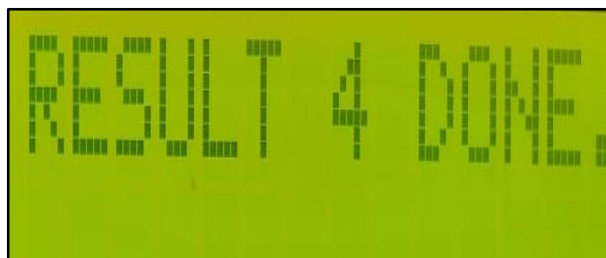

➤ **RESULT MODE**

I. SEQUENTIAL MODE: If sequential mode is selected, the following screen will appear.

SEQ-MODE: 0 DONE
CH1 LOAD COMP

A photograph of a yellow LCD screen with black pixelated text. The top line reads 'SEQ-MODE: 0 DONE' and the bottom line reads 'CH1 LOAD COMP'.

II. PUT COMPONENT REJECTION BIN

PUT COMPONENT IN
REJECTION BIN

A photograph of a yellow LCD screen with black pixelated text. The top line reads 'PUT COMPONENT IN' and the bottom line reads 'REJECTION BIN'.

6. Many peripherals can be connected to a Spade Super display unit

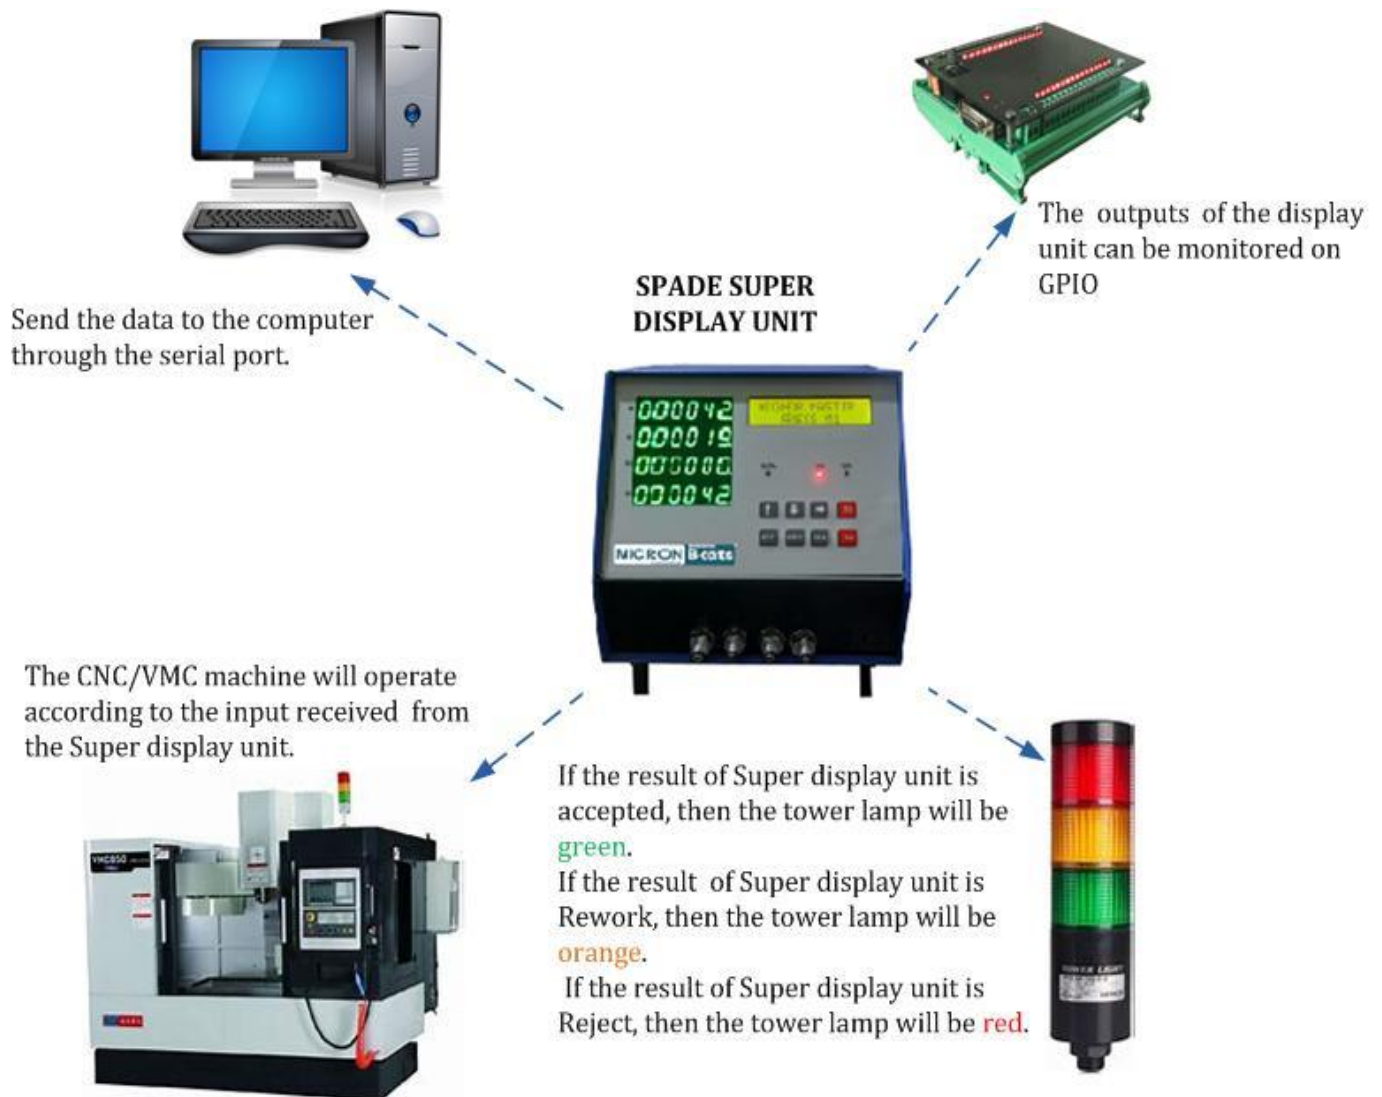


Figure 2

7. How to do mastering and calibration

A. Mastering

➤ Double Mastering

Note: When two reference masters are available for measurement, choosing double mastering is required for calibration. This is mandatory step. Double mastering must be done at least once before doing single mastering

1. Select double mastering.
2. Pressing M1, the screen will show the message 'PLACE PLUG IN HIGHER MASTER'.
3. After placing the plug into the higher master, press the M1 key, and the screen will show the message 'PROGRAM 01 CAPTURING M1'.
4. The screen will show the message 'PLACE PLUG IN LOWER MASTER'.
5. After placing the plug into the lower master, press the M2 key and the screen will show the message 'PROGRAM 01 CAPTURING M2.'
6. The message "MASTERING DONE ENTER TO SAVE" will display.

➤ Single Mastering

Note: When there is only one reference master available, choose single master mode. Single mastering will work only when double mastering is already done at least once for that program

1. Select single mastering.
2. Pressing M1, the screen will show the message 'PLACE PLUG IN MASTER'
3. After placing the plug into the master, press the M1 key, and the screen will show the message 'PROGRAM 01 CAPTURING M1'.
4. The message "MASTERING DONE ENTER TO SAVE" will display.

B. Calibration

➤ Simultaneous calibration

1. Select 'CALIBRATION MODE SIMULTANEOUS'.
2. Pressing M1, then the screen will show 'PLACE PLUG IN HIGHER MASTER'.
3. After placing the two channel plug into the higher master, press the M1 key and the screen will show the message 'PROGRAM 01 CAPTURING M1'.
4. The screen will show the message 'PLACE PLUG IN LOWER MASTER'.
5. After placing both channel plugs into the lower master, press the M2 key and the screen will show the message 'PROGRAM 01 CAPTURING M2'.
6. The message "MASTERING DONE ENTER TO SAVE" will display.

➤ Step calibration

1. Select 'CALIBRATION MODEL STEP CAL'.
2. Select calibration parameters 01 or 02 for calibration.
3. If parameter 01 is selected, the screen will show the message 'PLACE PLUG IN HIGHER MASTER'.
4. After placing the plug for that parameter in the higher master and pressing the M1 key, the screen will display the message 'PROGRAM 01 CAPTURING M1'.
5. The screen displays 'PLACE PLUG IN LOWER MASTER'.
6. After placing the plug for that parameter in the lower master and pressing the M2 key, the screen will display the message 'PROGRAM 01 CAPTURING M2'.
7. The message "MASTERING DONE ENTER TO SAVE" will display.

8. Connection details

➤ Result status relay connection

9 Pin round Connector	Relay Connection	Relay
1	NC	ACCEPT Relay
2	CMN	
3	NO	
4	NC	REJECT Relay
5	CMN	
6	NO	
7	NC	REWORK Relay
8	CMN	
9	NO	

Table 1

➤ Foot-switch connection

4 Pin round connector	Connection
1	Common
2	Footswitch-1
3	Footswitch-2
4	NC

Table 2

- To operate Foot-switch-1 connect one terminal of switch to common (pin1 of 4pin connector) and another terminal to Foot-switch-1 (pin2 of 4pin mx male connector).
- To operate Foot-switch-2 connect one terminal of switch to common (pin1 of 4pin mx male connector) and another terminal to Foot-switch-2(pin3 of 4pin mx male connector).

➤ Extension/cascading cable connections

Display Unit has mx 3pin male connector for extension interface. Using this feature user can cascade up to 5 units. For extension purpose DB9MALE to 3pin female three core cable is required. Below are pin details for this cable figure 3.

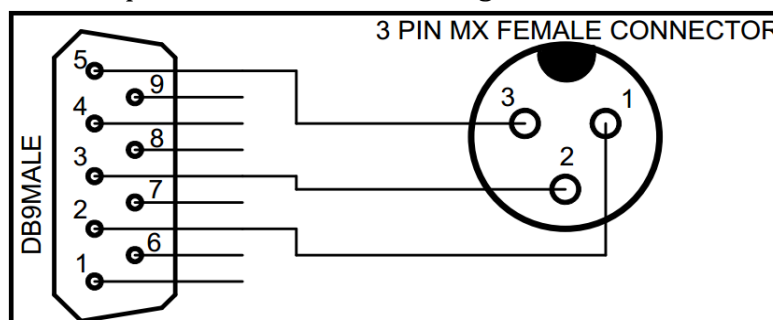


Figure 3

3-Pin round Male Connector On Backside	DB9 Female
1	RXD
2	TXD
3	GND

Table 3

➤ Serial Communication Port

Display unit has D sub miniature 9pin female connector for serial interface. Below are pin details for this connector. If the is being connected to computer's serial port, one to one straight three core cable is required.

DB9 Pin	Signal Name
1	NC
2	TXD RS232
3	RXD RS232
4	NC
5	GND
6	FOOT- SWITCH COMMON
7	FOOT- SWITCH-1
8	FOOT- SWITCH-2
9	P1.11

Table 4

Table Terminology

NC: Do not make any electrical connection to these pins. Some or all of these pins might be used for internal testing and factory settings.

GND: Supply negative

Warning: Wrong connection or over voltage at any of the D type connector pin may permanently damage the device


9. Measurement Cycle for Auto Program selection

For Auto program selection mode GPIO device should be properly connected to the display device. If GPIO device is not connected "INPUT EXTENSION NOT RESPONDING" error message shows on display screen.

- To start measurement cycle first check all the plugs are within the proximity of the sensor/rest position.
- Lift any one plug at a time then its respective program will be automatically selected.
- Put lifted plug into its respective component for measurement.
- Measurement status will be displayed on screen as Accept, Reject or Rework.
- Press "ENT" key or press foot switch once for saving the cycle result status into the device and at same time transmitting over serial port.
- Put plug back to its rest position.
- One measurement cycle completed.
- Repeat same procedure for all plugs.

10. Data Transmission Frame Format

A data frame is sent over RS232 port at predefined interval. All the data is in ASCII format and can be viewed on hyper terminal. Default interval setting is 50mSec and default baud rate is 19200. The data frame is always terminated by ASCII code of carriage return. The probe reading data are enclosed in REC delimiter and values within braces are separated by comma.

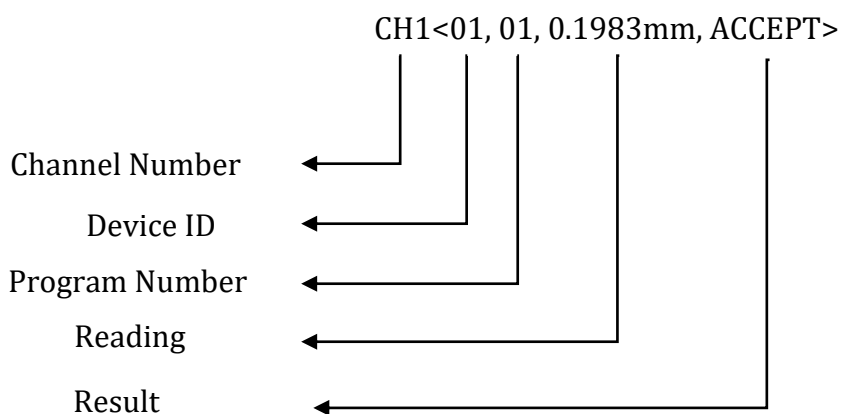

Warranty statement

All the products are covered under warranty for a period of 12 months against manufacturing defects, workmanship and malfunction under normal operating conditions. The warranty is subject to the terms and conditions mentioned below.

1. The warranty commences from the date of sale for a period of 12 months irrespective of the actual installation date.
2. The warranty is against manufacturing defects and any subsequent malfunction of the instrument during the normal operation. The warranty shall not be applicable in case of accidental damage, damage due to wrong operation, connection or conditions that are out of normal operating specifications.
3. MICRONBEATS Metrology Solutions, at its discretion may repair or replace the product depending on the condition of instrument, availability of spare parts and type of failure.
4. In case of warranty claim, the warranty period will not be extended and remains same as stated earlier from the date of sale.
5. Maximum liability of MICRONBEATS Metrology Solutions remains up to repair or replacement of the product only. Any damages or losses raised out of use of the instrument are not covered by this warranty. In any case, cost of the product will not be refunded.
6. In case of warranty claim, the product should be sent over to MICRONBEATS Metrology Solutions immediately after noticing the defect or failure. A detailed note of operating conditions in which fault occurred will be helpful in rectifying the defect.
7. Do not try to open or repair the instrument on your own. Warranty will stand null and void in such case. Products with tampered warranty seal will not be considered for warranty claims and regular service charges will be applicable.
8. In all claims, the company's decision will be final and legally binding.
9. Any and all disputes are subject to pune jurisdiction only.

Micronbeats Metrology Solutions
#226, Laxmi colony, Lane No.5,
Behind Manish
market, Hadapsar, Pune – 411028.
www.Micronbeats.com
Email: sales@micronbeats.com